

USER MANUAL



digital level DL-200

CONTENTS

FOREWORDS	3
PRECAUTIONS:	4
SAFETY GUIDE	5
OPERATOR	6
DECLARATION OF EXCEPTIONAL RESPONSIBILITY	6
1. NAME OF EACH COMPONENT & ITS FUNCTION	7
1.1 Name of Each Component	7
1.2 Operation Keys & Functions	9
1.3 Display.....	9
2. PREPARATION FOR MEASUREMENT.....	10
2.1 Mounting the Instrument.....	10
2.2 Power On.....	11
2.3 Remaining Battery Display.....	11
2.4 Setting the Data Save Mode	12
2.5 Main Menu	12
2.6 Staff Collimation and Focus	12
2.7 Surveying Note	13
3. MEASURE	14
3.1 Measure Mode.....	14
3.2 S.O GH (Stake out Ground Height).....	15
3.3 S.O HD (Stake out Height Difference).....	16
3.4 S.O Dist (Stake out Distance).....	17
3.5 Leveling	18
3.6 GH&HD.....	20
4. ADJUST	22
5. PARAMETER SETTING.....	24
6. DATA MANAGE	25
7. OTHER FUNCTIONS.....	26
7.1 Distance Display [DIST].....	26
7.2 Inverse Staff Mode [-].....	26
7.3 Horizontal Angle Measurement	26
7.4 Optical Distance Measure.....	26
8. BATTERY AND CHARGER	27
9. CIRCULAR VIAL ADJUSTMENT	27
10. TRANSPORTATION, STORING AND CLEANING	27
11. SPECIFICATION	29

FOREWORDS

Congratulations on your purchasing the Digital Level DL-202. In order to operate this instrument correctly, please read this user manual carefully and keep it well so as to refer to it easily in the future. Before use, please check the standard features and make sure all the equipments and accessories are available.

In order to facilitate reading, some pictures are simplified.

PRECAUTIONS:

Before using this instrument, please make sure that each function is running well.

- Avoid to make the surface of the digital staff as well as the joints between each section dirty or damaged, otherwise it will influence the accuracy of reading and measurement. This is because the instrument needs to transfer the black & white bar code to electric signal. That's why in case the digital staff is dirty, the accuracy would be decreased, or even the instrument is not able to measure.
- Tripod
The digital level should be mounted on wooden tripod. Metal tripod is lighter and it's easy to shake, which will affect the accuracy. Each leg of the tripod should be fixed well by screws.
- Tribach
In case the tribach is installed not properly, the accuracy would be influenced. Please inspect the adjusting screw on the tribach frequently and make sure the central fixing screw is tightened.
- Packing well to avoid the instrument shaken
As an precise instrument, the digital level should be handled carefully to avoid shaking and crashing during transportation. Severe shaking would damage the measurement functions. When packing the instrument in the case, make sure it is powered off and take off the battery.
- Carry the instrument carefully
When you need to move the instrument, you must grasp the lifting handle and take it off from the tripod.
- Avoid to expose the instrument in sun, rain or humid condition
Leaving the instrument in place of high temperature (+50°C) would damage the instrument. Do not shoot the sun with the objective lens, otherwise the spare parts inside the instrument may be damaged.
- Avoid a great change on temperature
A great change on instrument temperature would decrease the measuring range. For example, when the instrument is moved out from a hot car, please leave the instrument to adapt to the surrounding temperature before use.
- Battery Inspection
Check the remaining battery before use.
- Digital Staff
Wear a glove when using a digital staff.

SAFETY GUIDE

Serious injury or even death may occur if the following cautions are ignored.

- In case of explosion, do not place the instrument close to inflammable gas, liquid, or solid. Do not operate it in coal mine or dusty place.
- Do not disassemble or repair the instrument without authorization in case of possible dangers occurred like fire, electric shock or damage. Disassembling and maintenance are only implemented by the manufacturer and its authorized service providers.
- Do not use the telescope to sight at the sun or sunlight that are refracted by reflectors like prisms in case of any hurt to the eyes.
- Be careful to operate the instrument with the digital staff near high voltage cables or transformers, in case of electric shock accident.
- Do not use the digital staff when there are thunder and lightning in case of electric shock.
- Do not use chargers and batteries that are produced by a third party in case of fire.
- Do not use a broken power supply, wires, sockets and plugs in case of fire or electric shock.
- Do not use humid batteries or chargers in case of fire or electric shock.
- Do not place the batteries in fire or high-temperature environment in case of explosion or damage.
- Do not use the power supply mentioned in the manuals of non-manufacturers in case of fire or electric shock.
- Avoid short circuit when storing the batteries in case of fire.
- Do not disassemble or assemble the instrument or operate the plug with wet hands in case of electric shock.
- Do not cover the charger when it is charging in case of fire.
- Do not touch the liquid leaked from the battery in case of hurt by the harmful chemicals. And please change the battery.
- Injury to persons or damage to goods may occur if the following cautions are not followed by operators.
- Harm: means hurt, burn, electric shock, etc.
- Damage: means serious damage caused to building, instrument or furniture.
- Overturning the instrument case may damage the instrument.
- Do not stand or sit on the case.
- Do not use the instrument case with broken belt, buckle, hinge, or lifting handle, in case that the instrument is damaged or it hurts the legs if the case falls.
- When mounting or delivering the instrument, please be careful that the leg tips of the tripod may hurt people.
- Please make sure to mount the tribrach correctly. Serious damage will occur if the tribrach falls from the tripod.
- When mounting the instrument on the tripod, make sure the central fixing screw is tightened well to prevent the instrument from falling from the tripod.
- When mounting the instrument, make sure the screws of the tripod are tightened well.
- When moving the tripod, make sure the screws of the tripod are tightened

well.

OPERATOR


- This instrument is only operated by specific persons.
It is required that the operator should be a qualified surveyor. Before operation, inspection and calibration, operators should be acknowledged the safety guide.
- During using the instrument, please wear necessary suits for protection (e.g. safety shoes, safety helmet).
- Do not place the instrument directly on the ground. If the operator has to leave the instrument alone, please cover the instrument with a nylon cover (if available).

DECLARATION OF EXCEPTIONAL RESPONSIBILITY

- Users of this product should read the user manual thoroughly and implement periodical inspection to the performance of the instrument.
- Manufacturer and its dealers shall not be responsible for any direct or indirect consequences and profit loss resulted from destructive or intentional improper use.
- Manufacturer and its dealers shall not be responsible for any direct or indirect consequences and profit loss resulted from natural calamities (e.g. earthquake, hurricane, flood, etc.), fire, accidents, or fault of a third party.
- Manufacturer and its dealers shall not be responsible for failure to operate resulted from the fact that the data is changed or lost, or that operation is interfered.
- Manufacturer and its dealers shall not be responsible for any consequences and profit loss resulted from extra use without following the user manual.
- Manufacturer and its dealers shall not be responsible for any consequences and profit loss resulted from improper transportation or connecting with other products.


1. NAME OF EACH COMPONENT & ITS FUNCTION

1.1 Name of Each Component

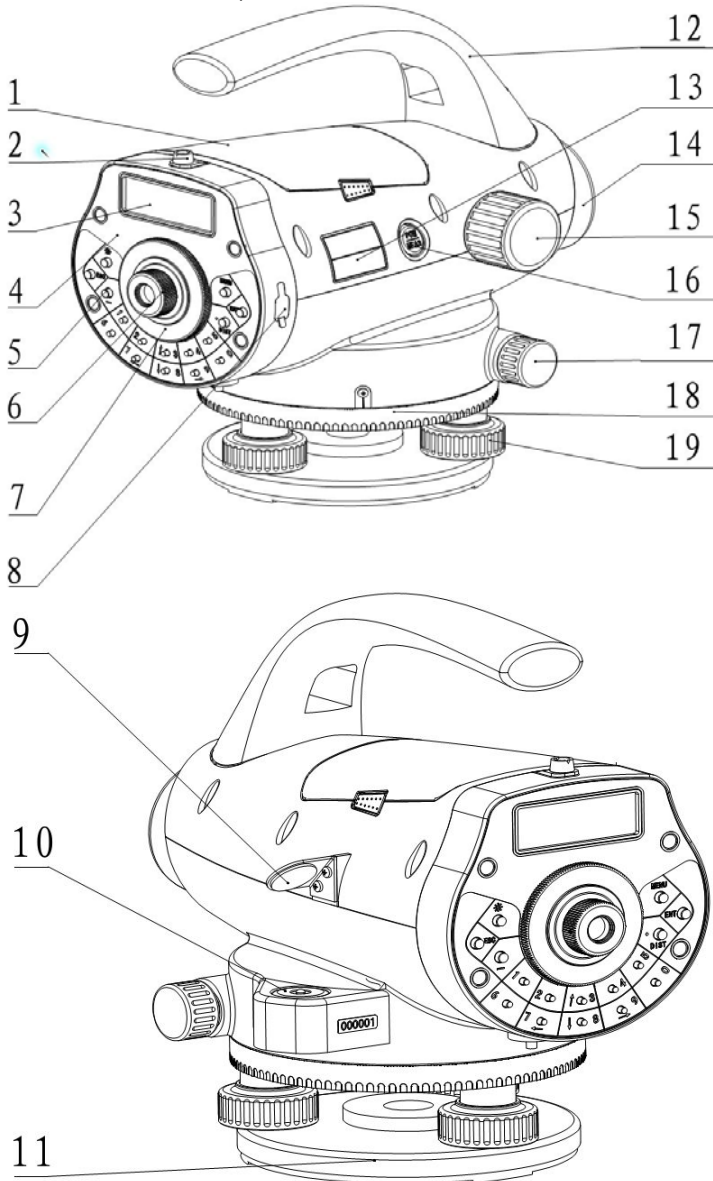


- 1 battery
- 2 rough collimator
- 3 LCD display
- 4 keyboard panel
- 5 keys
- 6 eyepieces: use for adjusting the definition of the crosshair.
- 7 protecting cover of eyepieces: by releasing this cover, you can implement the mechanical adjustment of the reticle in order to correct the optical collimation line error.
- 8 data transfer port: connecting with PDA or computer.
- 9 reflector of circular vial
- 10 circular vial
- 11 tribrach
- 12 lifting handle
- 13 model label
- 14 objective lens
- 15 focusing hand wheel: use for focusing of digital staff.
- 16 power/measure key: use for instrument power ON/OFF, and measure.
- 17 horizontal tangent hand wheel
- 18 horizontal dial: use for setting the horizontal direction value of the collimating direction to 0 or other required values.
- 19 leveling screws of the tribrach

1.2 Operation Keys & Functions

key	name	function
POW/MEAS	Power ON/OFF measure	Power ON/OFF, and start to measure. Power ON: press once; Power OFF: hold on for 2 seconds.
MENU	menu	Return to the menu list.
DIST	distance measure	In measurement status, press it to start measure the distance and display the distance.
↑↓	select	Turn the page of menu list or data list.
→←	number moving	Turn the left or right page when viewing the data, or move left or right in inputting status.
ENT	enter	To confirm the parameters or inputting data.
ESC	ESC	To escape from menu mode or any setting mode. Also to go backspace to delete a character in inputting mode.
0~9	number keys	Inputting numbers.
—	Mode of setting inverse staff	Use for inputting inverse staff. Set the inverse staff. You should activate this function in parameter setting first.
	illumination	Turn ON/OFF the illumination
.	decimal point	Inputting a decimal point

1.3 Display

The display adopts dot matrix LCD, displaying 2 lines, with 16 characters in each. LCD illumination ON/OFF.

By pressing  to turn ON or OFF the illumination. It is also available to set it in instrument parameters.

Setting Contrast

There're 9 degrees for the contrast. Please refer to parameter setting to know how to set the contrast.

2. PREPARATION FOR MEASUREMENT

2.1 Mounting the Instrument

Placing the Tripod.

Type E aluminum tripod with flat or dome head tripod is required.

- (1) Adjust the three legs of the tripod to a proper length and tighten the fixing screws at the middle of the leg.
- (2) Tighten the hexagonal nut on the head of the tripod in order to make the tripod legs not too loosen. Place the tripod on a certain point, expand the legs until the distance between each leg is about 1m. First, fix a leg, and move the other 2 legs to make the head of the tripod approximately leveled. If necessary, adjust the length of the tripod legs.
- (3) Trample the legs into the earth or fix it well on the ground.

Putting the Instrument on the Head of the Tripod.

Take out the instrument from the case carefully and place it on the head of the tripod.

- (1) Aim the tripod central screw to the center of the tribrach center and tighten the screw until it is fixed at the head of the tripod.
- (2) If you need to define an angle or a line through the horizontal dial, you should center the instrument precisely with a plummet.
- (3) Center the circular bubble by adjusting the three leveling screws of the tribrach. If you are using a dome headed tripod, you should slightly loosen the tripod central screw and rotate the instrument round the head of the tripod until the circular bubble is centered, then tighten the screw.

Mounting the Instrument on a Certain Point (centering)

If you need to measure an angle or alignment, please precisely center the instrument at a certain point with a plummet.


- (1) Hang the plummet at the plummet hook of the central screw of the tripod.
- (2) Adjust the plummet line to a proper height.
- (3) In case the instrument is not centered at the known point, you can move the instrument to that point without changing the position relationship between the tripod leg and its head. First, put the tripod on the known point approximately until the plummet is about 1cm away from the point. Second, grasp two legs of the tripod and adjust the tripod by the third leg until the head of tripod is leveled approximately with a proper height. Expand the legs of the tripod and fix it on the ground.
- (4) Finally, observe the plummet and the hook and trample the legs into the ground.
- (5) Slightly loosen the central screw of the tripod and move the instrument on the head until the plummet is centered at the known point. Tighten the tripod central screw.

Leveling the Instrument

Center the circular bubble by adjusting the tribrach screw.

First, put the tribrach as the below picture shown. Rotate 2 screws at the same time in opposite direction until the bubble moves to a position where the line between

the bubble and screw C is perpendicular to the line between screw A and B (refer to Picture A). Then rotate the screw C to move the bubble to the center of the central circle. This procedure should be repeated for times until the bubble is centered on any directions.

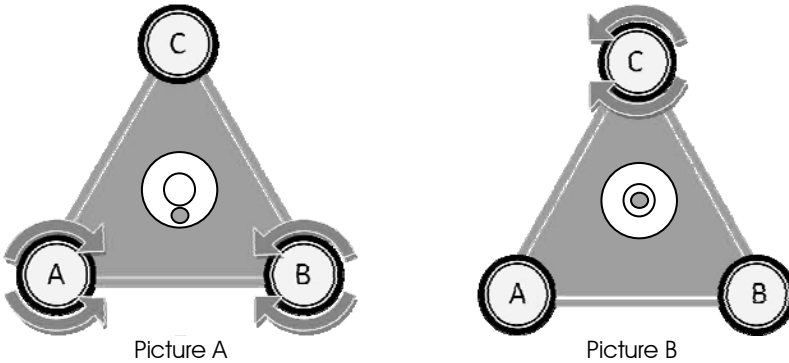

Notice: Do not touch the telescope during leveling.

Collimating and Focusing

- (1) Sight at the digital staff with the rough collimator.
- (2) Rotate the eyepiece slowly until the image of the crosshair becomes clear.
- (3) Rotate the focusing hand wheel until the image of digital staff becomes clear. Rotate the horizontal tangent to move the image of the staff to the center of the vertical hair of the crosshair.
- (4) Observe through the eyepiece. Move your eye slightly up, down, left and right to check whether the relative position between the crosshair and the image of the staff is not changed. If not, please return to step 1.


Notice: Measurement accuracy may be influenced if the crosshair and focusing is not clear.

2.2 Power On

Press the power key (POW/MEAS).

2.3 Remaining Battery Display

The battery symbol indicates the remaining battery.

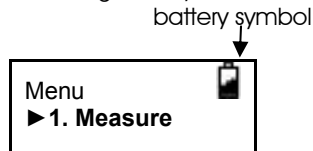

full



sufficient



half



battery low. Please change another battery or charge the battery.



unable to measure. The power will be cut off soon. You need to change the battery.

2.4 Setting the Data Save Mode

In order to save the measurement data into the internal memory of the instrument, before leveling measurement, the data saving mode should be set to auto save, as the default setting is "OFF".

2.5 Main Menu

	1 st Menu	2 nd Menu	3 rd Menu	4 th Menu	
Menu	Measure	Measure Mode			
		Stake out	S.O GH		
			S.O HD		
			S.O Dist		
		Leveling			
	GH&HD				
	Adjust				
	Set	Meas Para.	Meas.Mode	1.N Times	
				2.Continuous	
			Min.Reading	1 mm/0.5mm	
			Inverse Mode	Not Use/Use	
			Display Unit	m(meter)/ft(US. Ft)	
		Save Mode	OFF/Auto/Manual save		
		Ins. Para.	Auto OFF	On/Off	
			Contrast		
			Backlight	Off/On	
			Ins.Info		
	Regis.Info				
	Data Manage	Input PN			
		Search	Input PN/StdMeasData/ LvMeasData/GH/HD Data		
		Delete Job	Input PN/StdMeasData/ LvMeasData/GH/HD Data		
		Check Capa.			
		File Output	Input PN/StdMeasData/ LvMeasData/GH/HD Data		
		Format			

2.6 Staff Collimation and Focus

(1) Focusing

Adjust the eyepiece focusing screw until the crosshair can be seen clearly. Then adjust the focusing screw until you can see the staff clearly through the objective lens.

A precise focusing can shorten the measuring time and improve the accuracy. Measurement of high accuracy requests precise focusing as well as continuous measures.

(2) Obstacles

Measurement can be implemented if the staff is blocked less than 30%. Even if the crosshair center is blocked, as long as the field of view is blocked less than 30%, measurement still can be implemented. However, in this case, the accuracy might be affected.

(3) Shadow

The surveying accuracy may be influenced if the staff is covered by shadow. In some cases, it is not possible to measure.

(4) Backlight

If the background of the staff is too bright, which affects the contrast of the staff, the digital level might not be able to measure. You can cover something ahead of the objective lens in order to reduce the background light invading to the lens. When a strong light comes into the eyepiece, it might not be able to measure either. You can also cover the eyepiece in order to block the strong light from coming into the eyepiece.

When the sun is in a low position (for example, in the morning or at night fall), or if the sun light comes into the objective lens directly, it is suggested to block the sunlight with hands.

2.7 Surveying Note

In order to make full use of the functions of instrument, please pay attention to the following:

(1) Set up the staff in bright place. If possible, prolong the staff completely. If illumination is employed, it is suggested to illuminate the whole staff, otherwise the accuracy might be affected.

(2) The shortest distance between instrument and staff is 1.5m.

(3) It won't affect the digital level to measure if the staff is blocked. But if the bar code on the staff is blocked by tree branches or leaves, the digital level might display error, or the accuracy is influenced.

(4) If an error occurs because the place where the staff is put is darker than that of the eyepiece, you are suggested to block the light for the eyepiece.

(5) Deflection and pitching of the staff may affect the accuracy. During the measurement, make sure the staff is paralleled to the vertical hair of the reticle. The staff should be unfolded completely and fixed well. Make sure the joints of the staff are well and precise. Avoid to measure through the glass window.

(6) After a long storage or transportation, check and calibrate the digital and optical sight errors. Then adjust the circular vial and keep the optical parts clean.

3. MEASURE

3.1 Measure Mode

This mode is to measure the staff reading and distance without calculating the height. Refer to "Set" to set the measure times. Using the average value upon several times can improve the accuracy.

Operation Procedure	Operation	Display
1. Press [ENT]	[ENT]	Menu ▶1.Measure ↓
2. Press [▲] or [▼] to select the Measure Mode and press [ENT].	[ENT]	▶1.Measure Mode 2.Stake out ↓
3. If the saving mode is set to Auto save or Manual save:	[ENT]	Save Data? Y:ENT N:ESC ↓
4. Input the job name and press [ENT].	[1] [ENT]	Job Name? =>B1_ ↓
5. Collimate the staff until it looks clear and press [MEAS] to measure. The last value after several measures is the average value. Under continuous measure, press [ESC] to stop and record.	[MEAS]	Standard Mode Press MEAS ↓
6. Press [▲] [▼] to view the point. After saving, the point number will be increased automatically.	[▲] [▼]	Rod: 0.8050m Dist: 8.550m ↓
7. Press [ENT] to confirm or [ESC] to quit.	[ENT] to continue or [ESC] to quit.	Pn Num: P 1 ↓
8. In any process, press [ESC] continuous to return to main menu.	[ESC] to quit	Standard Mode Press MEAS ↓

3.2 S.O GH (Stake out Ground Height)

Under this mode, user can stake out by inputting the ground heights (GH) of backsight point and stakeout point.

Operation Procedure	Operation	Display
1. Press [ENT]	[ENT]	Menu ▶ 1.Measure ↓
2. Press [▲] [▼] to select “2.Stake out” and press [ENT].	[ENT]	1.Measure Mode ▶ 2.Stake out ↓
3. Select “S.O GH” (stake out ground height) and press [ENT].	[ENT]	▶ 1.S.O GH 2.S.O HD ↓
4. Input the ground height of the backsight point and press [ENT].	Input BS height	BS GH? =100_ m ↓
5. Input the ground height of the stakeout point and press [ENT].	Input BS height	SO GH? =101_ m ↓
6. Collimate the staff on backsight point until it looks clear and press [MEAS].	[MEAS]	Meas BS Pt Press MEAS ↓
7. It displays the backsight staff and the distance. Press [MEAS] to measure continuously or press [ENT] to go to next step, or press [ESC] to quit.	[ENT]	BRod: 0.8050m BDist: 8.550m
8. Collimate the staff on stakeout point until it looks clear and press [MEAS].	[MEAS] or [ENT] or [ESC]	Meas SO Pt Press MEAS ↓
It displays the stakeout rod reading and the distance. Press [ENT] to display the height and the value to fill or dig. “-” means to fill and “+” means to dig.		SRod: 0.6540m SDist: 7.633m ↓
		GH: 1.0300m HD: -3.9705m ↓
9. Press [ENT] to continue to stake out or press [ESC] to quit.		ENT: Continue ESC: New Meas ↓

 
 
 
 

 
 
3.3 S.O HD (Stake out Height Difference)

User can stake out by inputting the HDs (height differences) of the backsight point and the stakeout point.

Operation Procedure	Operation	Display
1. Press [ENT].	[ENT]	Menu ▶ 1.Measure ↓
2. Press [▲] or [▼] to select "layout" and press [ENT].	[ENT]	1.Measure Mode ▶ 2.Stake out ↓
3. Select Margin Out and press [ENT].	[ENT]	1.S.O GH ▶ 2.S.O HD ↓
4. Input the GH (ground height) of backsight point and press [ENT].	Input BS height [ENT]	BS GH? =100_ m
5. Input the HD (height difference) of the stakeout point and press [ENT].	Input VH of stakeout point [ENT]	SO HD? =1_ m
6. Collimate the staff until it looks clear and press [MEAS].	[MEAS]	Meas BS Pt Press MEAS
7. It displays the backsight rod reading and the distance. Press [MEAS] to measure continuously or press [ENT] to go to next step, or press [ESC] to quit.	[ENT]	BRod: 0.8050m BDist: 8.550m
8. Collimate the staff on stakeout point until it looks clear and press [MEAS].	[MEAS] or [ENT] or [ESC]	Meas SO Pt Press MEAS
It displays the stakeout rod reading and the distance. Press [ENT] to display the height and the value to fill or dig. "-" means to fill and "+" means to dig.		SRod: 0.6540m SDist: 7.633m
		GH: 1.0300m HD: -3.9705m
9. Press [ENT] to continue to stake out or press [ESC] to quit.	[ENT]	ENT: Continue ESC: New Meas


 
 
 
 
 
 
 
 
 
 
3.4 S.O Dist (Stake out Distance)









User can stake out by inputting the distance.

Operation Procedure	Operation	Display
1. Press [ENT].	[ENT]	
2. Press [▲] or [▼] to select "S.O Dist" (stake out distance) and press [ENT].	[ENT] [▼]	
	[ENT]	
3. Input the distance of stake out point and press [ENT].	Input the distance [ENT]	
4. Collimate the staff until it looks clear and press [MEAS].	[MEAS]	
5. Displays the distance and the difference. Press [MEAS] to measure continuously or press [ENT] to go to next step, or press [ESC] to quit.	[ENT]	
When the Δ Rod is positive, it indicates to move the staff backward. When the Δ Rod is negative, it indicates to move the staff forward.		

3.5 Leveling



In Leveling mode, the saving mode should be set to "Auto" or "Manual save". In this session we set it Auto Save.

Operation Procedure	Operation	Display
1. Press [ENT].	[ENT]	
2. Press [▲] or [▼] to select "Leveling" and press [ENT].	[▼]	
	[ENT]	
3. Input the job name and press [ENT].	Input job name [ENT]	
4. Input the point number of backsight point and press [ENT].	Input point number [ENT]	
5. Select whether to use the existed data.	[ENT]	
	[ENT]	
	[ENT]	
6. Collimate the staff until it looks clear and press [MEAS].	[MEAS]	
		
8. Press [▶] or [◀] to choose to measure FS (frontsight) point or intermediate point (Int.Pt). Now choose FS first.	[▶] or [◀] [ENT]	
	Input point	

<p>9. Input the point number of foresight point and press [ENT].</p> <p>10. Collimate the staff until it is clear and press [MEAS].</p> <p>11. Press [▶] or [◀] to choose to measure BS (backsight) point or Int (Intermediate point). Now choose intermediate point.</p> <p>12. Input the point number of the IntPt and press [ENT].</p> <p>13. Collimate the staff until the staff is clear and press [MEAS].</p> <p>14. Press [ESC] and [ENT] to quit.</p>	<p>number</p> <p>[ENT]</p> <p>[MEAS]</p> <p>[▶] or [◀] [ENT]</p> <p>Input point number [ENT]</p> <p>[MEAS]</p> <p>[ESC]</p> <p>[ENT]</p>	<div data-bbox="721 147 994 228">FS PN =>P2_ </div> <div data-bbox="721 245 994 326">Meas the FS Pt  PN: P2</div> <div data-bbox="721 342 994 423">FRod: 0.9550m  FDist: 8.486m</div> <div data-bbox="721 472 994 553">SelectPtType  BS ▶ Int</div> <div data-bbox="721 602 994 683">Int Pn  =>I2</div> <div data-bbox="721 716 994 797">Meas the Int Pt  PN: I1</div> <div data-bbox="721 813 994 894">IRod: 0.7395m  IDist: 8.501m</div> <div data-bbox="721 911 994 992">ENT: Continue  ESC: New Meas</div>
---	--	--

After measurement, below data will be displayed.

After measuring the backsight point, press [▲] or [▼] to show the following screen.

<p>BRod: 1.022m  BDist: 15.07m</p>	<p>Measurement value of backsight point</p>
<p>G H: 21.555m  PN: P01</p>	<p>Ground height of backsight point Point number of backsight point</p>

When the current measurement finishes, press [▲] or [▼] to display the following screen.

FRod: 1.032m FDist: 15.07m	Measurement value of front sight point
G H: 22.555m PN: P05	Ground height of front sight point Point number of front sight point
H D: 0.532m Σ: 25.003m	Height distance of this station Total length

When the measurement of interval point is finished, press [▲] or [▼] to display the following screen.

IRod: 1.022m IDist: 15.07m	Measurement value of intermediate point point
G H: 21.555m PN: P01	Ground height of intermediate point Point number of intermediate point











Explanation about the middle point number of leveling measurement.

Before front sight measurement you can change the point number. It starts with P and 5 numbers following, which will be increased. Those point numbers that are used can be used again.

3.6 GH&HD

This mode can measure the GH (ground height) or HD (height difference) of the backsight point before measurement.

Operation Procedure	Operation	Display
1. Press [ENT].	[ENT]	Menu ▶1.Measure ↓
2. Press [▲] or [▼] to select "GH&HD" and press [ENT].	[▼]	1.Measure Mode ▶2.Stake out ↓ 3.Leveling ▶4.GH&HD ↓



<p>3. Press [ENT] to save the data.</p> <p>4. Input the job name and press [ENT].</p> <p>5. Input the GH (ground height) of the backsight point.</p> <p>6. Collimate the staff until it looks clear and press [MEAS].</p> <p>7. It displays the backsight rod reading and the distance. Press [MEAS] to measure continuously or press [ENT] to measure next point.</p> <p>8. Collimate the staff on the front sight point until it looks clear and press [MEAS].</p> <p>9. It displays the front sight rod reading and the its ground height and height difference.</p> <p>10. Press [ESC] to restart the measurement.</p>	<p>[ENT]</p> <p>Input job name [ENT]</p> <p>[ENT]</p> <p>Input point number [ENT]</p> <p>[MEAS]</p> <p>[MEAS]</p> <p>[ESC]</p>	<div data-bbox="718 164 989 240"> <p>Save Data?  Y: ENT N:ESC</p> </div> <div data-bbox="718 280 989 357"> <p>Job Name?  =>H5_</p> </div> <div data-bbox="718 414 989 490"> <p>Input BS GH?  Y:ENT N:ESC</p> </div> <div data-bbox="718 514 989 591"> <p>BS GH?  =168.680m</p> </div> <div data-bbox="718 615 989 691"> <p>Meas BS Pt  Press MEAS</p> </div> <div data-bbox="718 732 989 808"> <p>BRod: 0.841m  BDist: 10.005m</p> </div> <div data-bbox="718 833 989 909"> <p>Meas FS Pt  Press MEAS</p> </div> <div data-bbox="718 950 989 1026"> <p>FRod: 0.841m  FDist: 10.005m</p> </div> <div data-bbox="718 1050 989 1127"> <p>GH: 168.479m  HD: -0.001m</p> </div> <div data-bbox="718 1151 989 1227"> <p>Exit?  Y:ENT N:ESC</p> </div>
--	--	--

4. ADJUST

Inspection of the collimating sight line (i angle) of the instrument.





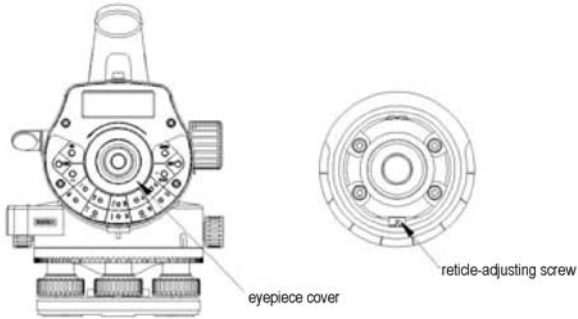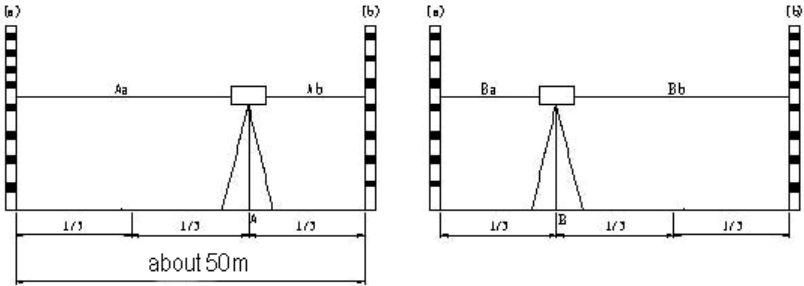



(1) As Picture 1 displays, mount the instrument on a tripod between 2 staff which is 50m away from each other. Divide the distance between A and B into 3 sessions with the same distance.

(2) Level the instrument.



(3) Process:

Operation Procedure	Operation	Display
1. Select "Adjust" in the menu and press [ENT].	[▲] or [▼] [ENT]	Menu ▶ 1.Measure ↓
2. Press [MEAS].	[MEAS]	▶ 2.Adjust 3.Set ↓
3. Press [ENT].	[ENT]	Adjust a< ---A-----b
4. Press [MEAS].	[MEAS]	Adjust Aa Rod:0.801m
		Adjust a ----A----- >b

<p>5. Press [ENT].</p> <p>You can power off the instrument and move it.</p>	<p>[ENT]</p>	<div data-bbox="723 155 994 233">Adjust Ab Rod:1.023m </div> <div data-bbox="723 245 994 323">Relocate A----->B </div>
<p>6. Press [MEAS].</p>	<p>[MEAS]</p>	<div data-bbox="723 354 994 431">Adjust a<----B-----b </div>
<p>7. Press [ENT].</p>	<p>[ENT]</p>	<div data-bbox="723 440 994 518">Adjust Ba Rod:0.808m </div>
<p>8. Press [MEAS].</p>	<p>[MEAS]</p>	<div data-bbox="723 550 994 628">Adjust a----B----->b </div>
<p>9. Press [ENT].</p>	<p>[ENT]</p>	<div data-bbox="723 660 994 738">Adjust Bb Rod:1.030m </div>
<p>10. Press [▲] or [▼] and [ENT].</p>	<p>[▲] or [▼] [ENT]</p>	<div data-bbox="723 771 994 849">0.0000m  0"</div>
<p>11. Press [ENT].</p>	<p>[ENT]</p>	<div data-bbox="723 857 994 935">0.0000m  0"</div>






5. PARAMETER SETTING

Meas Para.	Meas.Mode	N Times/Continuous
	Min.Reading	1 mm/0.5mm
	Inverse Mode	Not Use/Use
	Display Unit	m(meter)/ft(US. ft)
	Save Mode	OFF/Auto/Manual save
Ins.Para.	Auto OFF	On/Off
	Contrast	1~9
	Backlight	Off/On
	Ins.Info	Date/SN#
	Regis.Info	

Setting the measuring times of average measurement.

Operation Procedure	Operation	Display
1. Press [▲] or [▼] and [ENT] to select "Set".	[▲]or[▼] [ENT]	<div style="border: 1px solid black; padding: 5px;">Menu </div> <div style="border: 1px solid black; padding: 5px;">▶ 1.Measure </div> <div style="border: 1px solid black; padding: 5px;">2.Adjust </div> <div style="border: 1px solid black; padding: 5px;">▶ 3.Set </div> <div style="border: 1px solid black; padding: 5px;">▶ Meas Para. </div> <div style="border: 1px solid black; padding: 5px;">Ins.Para.</div>
2. Press [ENT].	[ENT]	<div style="border: 1px solid black; padding: 5px;">▶ 1. Meas.Mode </div> <div style="border: 1px solid black; padding: 5px;">2. Min.Reading </div>
3. Press [▲] or [▼] and [ENT].	[▲]or[▼] [ENT]	<div style="border: 1px solid black; padding: 5px;">▶ 1. N Times </div> <div style="border: 1px solid black; padding: 5px;">2. Continuous</div>
4. Press [ENT].	[ENT]	<div style="border: 1px solid black; padding: 5px;">Meas Times? </div> <div style="border: 1px solid black; padding: 5px;">N=1 (1-9)</div>
5. Input the times and press [ENT].	Press times [ENT]	<div style="border: 1px solid black; padding: 5px;">Meas Times? </div> <div style="border: 1px solid black; padding: 5px;">N=5 (1-9)</div>

     6. DATA MANAGE

Operation Procedure	Operation	Display
1. Press [▲] or [▼] to Data Manage.	[▲]or[▼] [ENT]	
2. Press [ENT].	[ENT]	
3. Press [▲] or [▼] and [ENT] to select.	[▲] or [▼] [ENT]	
		
		

Input Pn

User can input the point number and height to search for the base point in leveling measurement.

Search

User can search for input point, standard measurement data, leveling measurement data and GH/HD data.

Delete Job

User can delete input point, standard measurement data, leveling measurement data and GH/HD data.

Check Capa.

User can check the capacity of the internal memory.

File Output

User can export the input point, standard measurement data, leveling measurement data and GH/HD data to the computer. (Baud rate:9600, data length:8, stop:1, no parity)

According to file types, user can add the extension following the rules below:

.L: leveling data

.M: measurement data

.H:GH/HD data

.T:input point data

Format:

User can format the internal memory.

7. OTHER FUNCTIONS

7.1 Distance Display [DIST]

Use the [DIST] to measure the distance before surveying, to make sure the distances between the front sight and back sight are same.

7.2 Inverse Staff Mode [-]

Under this model, staff can be inverted for the ceiling measure.


Firstly, set the "Inverse Mode" to "Use" in the Meas.Para. setting. Before pressing MEAS, press the [-] button. The battery symbol and symbol "I" will appear alternately on the upper right corner of the screen. That means the Inverse Mode is activated.

7.3 Horizontal Angle Measurement

This instrument is equipped with a horizontal dial which can be used for horizontal angle measurement. Every 1° with a graduation, every 10° with a mark in the dial, and the graduation increases from 0° to 350° in clockwise direction.

(1) First, set up and level the instrument in start point C. Second, sight the telescope to backsight point A, and rotate the horizontal tangent screw until crosshair is accurately on the staff at point A. Rotate the horizontal dial at 0° .

(2) Sight the telescope to point B, and adjust the horizontal tangent, until the crosshair is accurately on the staff at point B. And the angle reading is angle between target A and target B, i.e. $\angle ACB$.

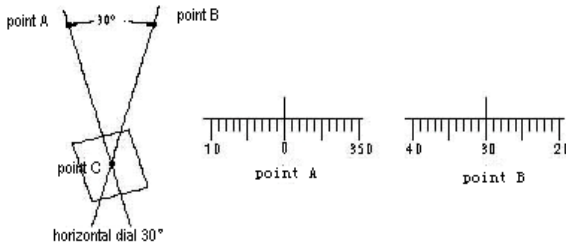


7.4 Optical Distance Measure

With the stadia hair of the instrument and the graduation on the staff, you can measure the distance easily. The stadia interval on the staff multiplies 100 is the distance. The stadia interval is the interval between the upper hair and the lower hair on the reticle.

(1) Set up the staff on the target point.

(2) Set up and level the instrument. Sight the telescope to the staff. Record the stadia interval between upper hair and lower wire as "I".

(3) The distance "L" between instrument and staff is $L = 100 \times I$.

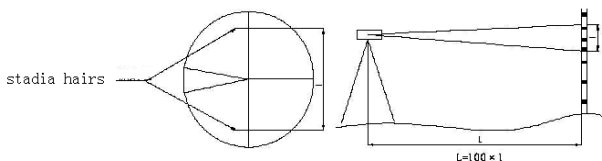

8. BATTERY AND CHARGER

The on-board battery is B-21.

Charging

(1) The output voltage of the charger is AC110V~220V. The electric current is 450mA.

(2) Red light means the battery is being charged. Green light means charging is finished.

(3) It will take 5 hours to charge the battery.

Note: a. Charging should be in a temperature of 10°C~40°C

b. When the charging time exceeds the suggested charging time, the battery life might be shortened.

c. The battery may discharge in storage. Inspect the battery before use if the instrument is stored for a long time.

d. The battery should be stored in a temperature below 30°C, and should be recharged every three or four months.

9. CIRCULAR VIAL ADJUSTMENT

1. Mount the instrument on a tripod. Center the circular vial precisely by rotating the 3 tribrach screws.

2. Rotate the instrument 180°. If the bubble is not in the center, the circular vial should be calibrated as follow:

a. Firstly, identify the bubble moving direction, and adjust the corresponding screws to move the bubble half of the offset.

b. Level the circular vial with the 3 tribrach screws again.

c. rotate the instrument around again to check whether the bubble is centered in every direction. If not, please repeat the steps a & b until the bubble is centered.

10. TRANSPORTATION, STORING AND CLEANING

Transportation

(1) In outdoor operation, the instrument should be stored in the carrying case, or fixed on the tripod and carried on the shoulder. Make sure not to carry the instrument upside down.

(2) In road transportation, do not leave too much space between instrument cases. Normally, the instrument should be stored in a special case in road transportation.

(3) In plane, train or ship transportation, the instrument should be stored in original carrying case and carton.

(4) Delivering the battery: related law and rules should be totally understood. Inform the carrier before the shipment.

Storage

(1) Notice the temperature when storing the instrument, especially the temperature inside the car in hot summer.

(2) The battery should be removed if the instrument is going to be stored for a long time.

(3) Do not store the wet instrument into the case before it is wiped dry.

Clean

(1) Clean the instrument after use.

a. If the instrument is wet by seawater, it should be wiped with a wet cloth and then be dried by a dry cloth.

b. Wipe the dust on the instrument with a clean brush and a soft cloth. Do not blow it with compressed air.

c. Wipe the dust on the objective lens with a clean brush, and wipe it with cotton with mixture of alcohol and aether.

(2) When cleaning the plastic parts of the instrument, do not use volatile liquid such as thinner and benzene. Neutral cleansing is suggested.

(3) Clean the staff after use, otherwise it will influence the accuracy. Do not use volatile liquid such as thinner and benzene to clean the staff.

(4) Store the staff in safe place. It is suggested to cover the joints of the staff with a cloth.

11. SPECIFICATION

		DL-202
height accuracy (standard deviation for 1km double run leveling)	digital reading	1.5mm
	optic reading	2.0mm
distance accuracy	digital reading	$D \leq 10m: 10mm; D > 10m: D * 0.001$
distance range	digital reading	1.5m~100m
minimum display	HD	1mm/0.5mm
	distance	0.1/1cm
measuring time		within 3s in normal condition
telescope	magnification	32×
	resolving power	3"
	field of view	1°20'
	multi-constant	100
	add-constant	0
compensator	type	magnetic-damped
	range	$> \pm 12'$
	accuracy	0.50"/1'
data storage	storage	16MB
	point number	increasing
	connection	mini-B
circular vial	accuracy	8'/2mm
auto power off		5minutes/OFF
horizontal dial	graduation	1°
display		LCD display of 128*32dpi with illuminator
temperature tolerance		-20°C~50°C
dimension		230 (L)×150 (W)×210mm(H)
weight		2.5kg