# **HS-100 Accelerometer**

# AC acceleration output via M12 Connector


# **Key Features**


- · Most common seller
- · For use with data collector
- · Customizable features

#### Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



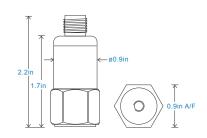

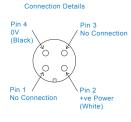

# **Technical Performance**

Mounted Base Resonance see 'How To Order' table (nominal) Sensitivity see: 'How To Order' table ±10% Nominal 80Hz at 72°F Frequency Response 120cpm (2Hz) to 600kcpm (10kHz) ± 5% 90cpm (1.5Hz) to 720kcpm (12kHz) ± 10% 48cpm (0.8Hz) to 900kcpm (15kHz) ± 3dB

Isolation Base isolated Range see: 'How To Order' table Transverse Sensitivity Less than 5%

### Mechanical

Case Material Sensing Element/Construction Mounting Torque Weight Sheilded Cable Assembly

Mounting Threads

Stainless Steel PZT/Compression 5.9ft. lbs 3.7 oz. (nominal) body only HS-AC010 - straight HS-AC011 - right angle see: 'How To Order' table


#### Electrical

**Excitation Voltage:** 18-30Volts DC **Electrical Noise** 0.1mg max Current Range 0.5mA to 8mA Bias Voltage 10 - 12 Volts DC Settling Time 2 seconds Output Impedance 200 Ohms max. >108 Ohms at 500 Volts Case Isolation

#### Environmental

-67 to 284°F Operating Temperature Range IP67 Sealing Maximum Shock 5000g **EMC** EN61326-1:2013

#### Typical Frequency Response (at 100mV/g)

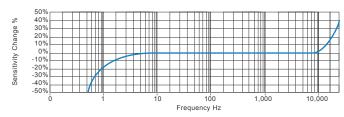


#### **Applications**

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



# How To Order

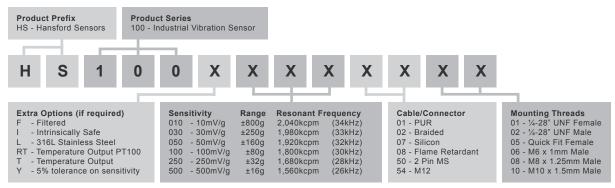



www.hansfordsensors.com sales@hansfordsensors.com

