HS-420RT Accelerometer

4-20mA velocity and PT100 temperature output via M12 Connector


Key Features

- For use with PLC/DCS systems
- PT100 temperature output

Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



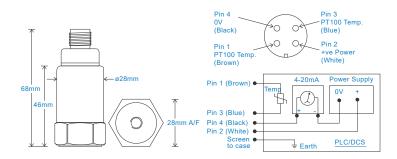

Connection Details

Technical Performance

Mounted Base Resonance 5kHz min

Velocity Ranges see: 'How To Order' table ±10%

Nominal 80Hz at 22°C

Frequency Response 10Hz (600cpm) to 1kHz (60kcpm) ± 5% - ISO10816

Isolation Base isolated

Range 50g peak

Temperature Output PT100 (100 Ohms)

Transverse Sensitivity Less than 5%

Mechanical

Case Material Stainless Steel
Sensing Element/Construction PZT/Compression
Mounting Torque 8Nm
Weight 150gms (nominal) body only
Screened Cable Assembly HS-AC010 - straight
HS-AC011 - right angle
Mounting Threads see: 'How To Order' table


Electrical

Current Output 4-20mA DC proportional to Velocity Range Supply Voltage 15-30 Volts DC (for 4-20mA) Settling Time 2 seconds Output Impedance Loop Resistance 600 Ohms max. at 24 Volts Case Isolation >108 Ohms at 500 Volts

Environmental

Operating Temperature Range	-25 to 90°C
Sealing	IP67
Maximum Shock	5000g
EMC	EN61326-1:2013

Typical Frequency Response



Applications

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



How To Order

