HS-420SRT Accelerometer

4-20mA velocity and PT100 temperature output via M12 Connector


Key Features


- · For use with PLC/DCS systems
- PT100 temperature output

Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



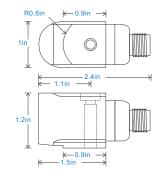

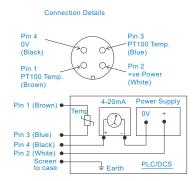

Technical Performance

Mounted Base Resonance 5kHz min

Velocity Ranges see: 'How To Order' table ±10%

Nominal 80Hz at 72°F

Frequency Response 600cpm (10Hz) to 60kcpm (1kHz) ± 5% - ISO10816

Isolation Base isolated Range 50g peak Temperature Output PT100 (100 Ohms) Transverse Sensitivity Less than 5%

Mechanical

Case Material Stainless Steel
Sensing Element/Construction PZT/Shear
Mounting Torque 5.9ft. lbs
Mounting Bolt Provided see: 'How To Order' table x 1.2in long
Weight 6.5 oz. (nominal) body only
Sheilded Cable Assembly HS-AC010 - straight
HS-AC011 - right angle
Mounting Threads see: 'How To Order' table

Electrical

Current Output

4-20mA DC proportional to Velocity Range
Supply Voltage

15-30 Volts DC (for 4-20mA)
Settling Time

1 second
Output Impedance
Loop Resistance 600 Ohms max. at 24 Volts
Case Isolation

>108 Ohms at 500 Volts

Environmental


 Operating Temperature Range
 -13 to 194°F

 Sealing
 IP67

 Maximum Shock
 5000g

 EMC
 EN61326-1:2013


Typical Frequency Response




Applications

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



How To Order

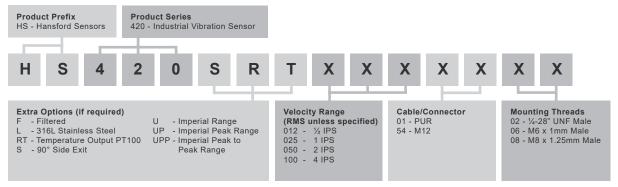



www.hansfordsensors.com sales@hansfordsensors.com

