



Pressure gauge with limit marker

G45D Series

Easy visual inspection management thanks to the green arrow.

● Port size: R1/8, R1/4

JIS symbol




Specifications

Descriptions	G45D	
Working fluid	Compressed air	
Fluid temperature °C	5 (41°F) to 60 (140°F)	
Ambient temperature °C	5 (41°F) to 60 (140°F)	
Accuracy *1	JIS2.5 grade or equivalent	
Shape	DT type (rear side screw/stock section square)	
Display size	φ39	
Material	Stock/Bourdon tube	Copper alloy
	Housing	Steel plate + paint (white)
	Lens	Polyamide resin
	Marker	Polyacetal resin
Pressure range MPa	0 (≈0 psi, 0 bar) to 0.2 (≈29 psi, 2 bar) 0 (≈0 psi, 0 bar) to 0.4 (≈58 psi, 4 bar) 0 (≈0 psi, 0 bar) to 1.0 (≈150 psi, 10 bar)	
(Setting range)		
Port size	R1/8, 1/4	
Weight g	74	

*1: The guaranteed indicator accuracy temperature is 20±15°C.

How to order

G45D - 6 - P04

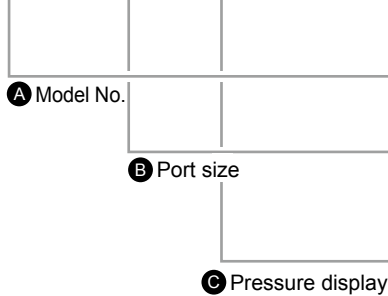


Code	Content
A Model No.	
G45D	Pressure gauge with limit marker
B Port size *1	
6	R1/8
8	R1/4
C Pressure display	
P02	0 to 0.2 MPa
P04	0 to 0.4 MPa
P10	0 to 1.0 MPa

⚠ Precautions for model No. selection



*1: NPT and G screws are available as custom orders.

Adjustment

Turn the transparent face counterclockwise and pull it off forward.
Set the limit marker by moving the green arrow marker with a flathead screwdriver. After adjustment, always reattach the transparent face before supplying pneumatic pressure.
When setting the limit marker, take care not to bend the other indicators or to scratch the dial plate.
The limit markers do not exactly coincide with each other. A clearance of approx. one gradient may form.

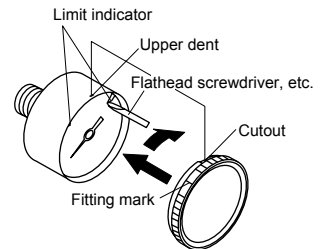

Dimensions

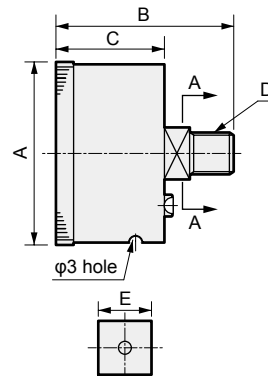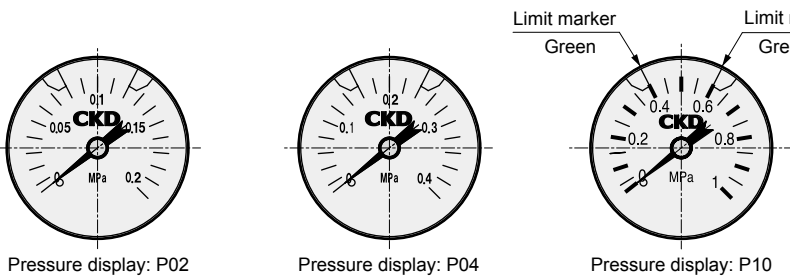

Cross section A-A

Model No.	A	B	C	D	E
G45D-6	φ39	41.5	26	R1/8	14
G45D-8	φ39	44.5	26	R1/4	14