



Series
2000

Magnehelic® Differential Pressure Gages

Indicate Positive, Negative or Differential, Accurate within 2%



RUBBER PRESSURE RELIEF PLUG
WILL UNSEAT ITSELF WHEN GAGE
IS OVERPRESSURIZED

.025 [.64] SPACE CREATED BY 3 SPACER
PADS WHEN SURFACE MOUNTED.
DO NOT OBSTRUCT. PROVIDES PATH
FOR RELIEF OF OVERPRESSURE.

[3] 6-32 X 3/16 [4.76] DEEP
HOLES EQUALLY SPACED ON
A Ø4-1/8 [104.78] BOLT CIRCLE
FOR PANEL MOUNTING

17/32 [13.49]

1-1/4 [31.75]

Ø4-1/2 [114.3]

15/32 [11.91]

1-11/16 [42.86]

1/8 FEMALE
NPT HIGH
PRESSURE
CONNECTION

1/8 FEMALE
NPT LOW
PRESSURE
CONNECTION

1-3/4 [44.45]

1/2 [12.70]

11/16 [17.46]

1/8 FEMALE NPT
HIGH PRESSURE
CONNECTION

1/8 FEMALE NPT
LOW
PRESSURE
CONNECTION

1-1/4 [31.75]

Ø4-1/2 [114.3]

15/32 [11.91]

Ø5-1/2 [139.70]

MOUNTING RING

17/32 [13.49]

Ø4-3/4 [120.65] PANEL CUTOUT

Ø5 [127]

Ø4-47/64 [120.27]

2-17/32 [64.29]

3/16 [4.76]

1-3/4 [44.45]

1/2 [12.70]

11/16 [17.46]

1/8 FEMALE NPT
HIGH PRESSURE
CONNECTION

1/8 FEMALE
NPT LOW
PRESSURE
CONNECTION

Select the Dwyer® Magnehelic® gage for high accuracy – guaranteed within 2% of full-scale – and for the wide choice of 81 models available to suit your needs precisely. Using Dwyer's simple, frictionless Magnehelic® gage movement, it quickly indicates low air or non-corrosive gas pressures – either positive, negative (vacuum) or differential. The design resists shock, vibration and over-pressures. No manometer fluid to evaporate, freeze or cause toxic or leveling problems. It's inexpensive, too.

The Magnehelic® gage is the industry standard to measure fan and blower pressures, filter resistance, air velocity, furnace draft, pressure drop across orifice plates, liquid levels with bubbler systems and pressures in fluid amplifier or fluidic systems. It also checks gas-air ratio controls and automatic valves, and monitors blood and respiratory pressures in medical care equipment.

MOUNTING


A single case size is used for most models of Magnehelic® gages. They can be flush or surface mounted with standard hardware supplied. Although calibrated for vertical position, many ranges above 1" may be used at any angle by simply re-zeroing. However, for maximum accuracy, they must be calibrated in the same position in which they are used. These characteristics make Magnehelic® gages ideal for both stationary and portable applications. A 4-9/16" hole is required for flush panel mounting. Complete mounting and connection fittings, plus instructions, are furnished with each instrument. Ⓢ

ACCESSORIES



Model A-432 Portable Kit

Combine carrying case with any Magnehelic® gage of standard range, except high pressure connection. Includes 9 ft (2.7 m) of 3/16" ID rubber tubing, standhang bracket and terminal tube with holder.

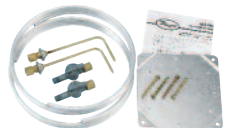

Model A-605 Air Filter Gage Accessory Kit

Adapts any standard Magnehelic® gage for use as an air filter gage. Includes aluminum surface mounting bracket with screws, two 5 ft (1.5 m) lengths of 1/4" aluminum tubing two static pressure tips and two molded plastic vent valves, integral compression fittings on both tips and valves.

A-605B Air Filter Gage Accessory Kit, Air filter kit with two plastic open/close valves, two 4" steel static tips, plastic tubing and mounting flange

A-605C Air Filter Gage Accessory Kit, Air filter kit with two plastic open/close valves, two plastic static tips, plastic tubing and mounting flange

SPECIFICATIONS

Service: Air and non-combustible, compatible gases (natural gas option available). **Note:** May be used with hydrogen. Order a Buna-N diaphragm. Pressures must be less than 35 psi.

Wetted Materials: Consult factory.

Housing: Die cast aluminum case and bezel, with acrylic cover. Exterior finish is coated gray to withstand 168 hour salt spray corrosion test.

Accuracy: ±2% of FS (±3% on -0, -100 Pa, -125 Pa, 10MM and ±4% on -00, -60 Pa, -6MM ranges), throughout range at 70°F (21.1°C).

Pressure Limits: -20 in Hg to 15 psig (-0.677 to 1.034 bar); MP option: 35 psig (2.41 bar); HP option: 80 psig (5.52 bar).

Overpressure: Relief plug opens at approximately 25 psig (1.72 bar), standard gages only. Ⓢ

Temperature Limits: 20 to 140°F* (-6.67 to 60°C), -20°F (-28°C) with low temperature option.

Size: 4" (101.6 mm) diameter dial face.

Mounting Orientation: Diaphragm in vertical position. Consult factory for other position orientations.


Process Connections: 1/8" female NPT duplicate high and low pressure taps - one pair side and one pair back.

Weight: 1 lb 2 oz (510 g), MP & HP 2 lb 2 oz (963 g).

Standard Accessories: Two 1/8" NPT plugs for duplicate pressure taps, two 1/8" pipe thread to rubber tubing adapter, and three flush mounting adapters with screws. (Mounting and snap ring retainer substituted for three adapters in MP & HP gage accessories.)

Agency Approval: RoHS. **Note:** -SP models not RoHS approved.

*For applications with high cycle rate within gage total pressure rating, next higher rating is recommended. See Medium and High pressure options.

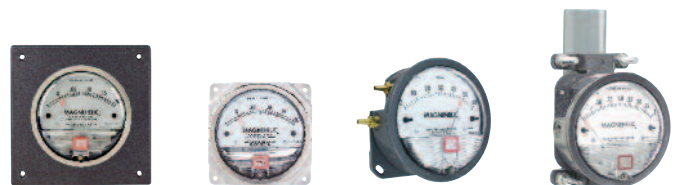

Flush, Surface, Integrated Plate or Pipe Mounted



Enclosure Mounted

Ⓢ See page 7 (Magnehelic® Gage Mounting Accessories)
Ⓣ Over Protection Note: See page 5 (Series 2000)



Series
2000

Magnehelic® Gage Models & Ranges

Bezel provides flange for flush mounting in panel.

Clear plastic face is highly resistant to breakage. Provides undistorted viewing of pointer and scale.

Precision litho-printed scale is accurate and easy to read.

Calibrated range spring is flat spring steel. Small amplitude of motion assures consistency and long life. It reacts to pressure on diaphragm. Live length adjustable for calibration.

Red tipped pointer of heat treated aluminum tubing is easy to see. It is rigidly mounted on the helix shaft.


Pointer stops of molded rubber prevent pointer over-travel without damage.

"Wishbone" assembly provides mounting for helix, helix bearings and pointer shaft.

Jeweled bearings are shock-resistant mounted; provide virtually friction-free motion for helix. Motion damped with high viscosity silicone fluid.

Helix is precision made from an alloy of high magnetic permeability. Mounted in jeweled bearings, it turns freely, following the magnetic field to move the pointer across the scale.

Zero adjustment screw is conveniently located in the plastic cover, and is accessible without removing cover. O-ring seal provides pressure tightness.

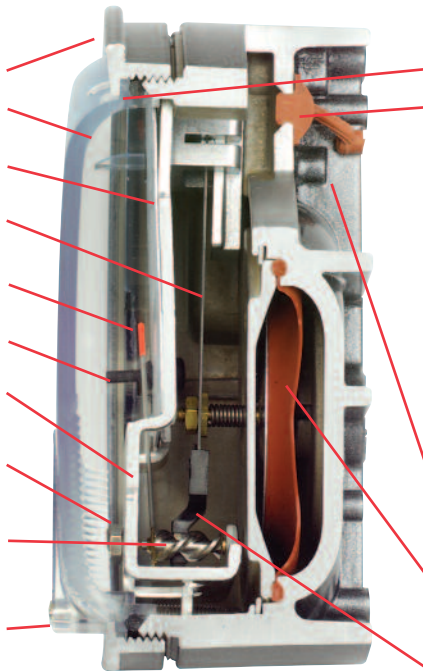

O-ring seal for cover assures pressure integrity of case.

OVERPRESSURE PROTECTION
Blowout plug is comprised of a rubber plug on the rear which functions as a relief valve by unseating and venting the gage interior when over pressure reaches approximately 25 psig (1.7 bar). To provide a free path for pressure relief, there are four spacer pads which maintain 0.023" clearance when gage is surface mounted. Do not obstruct the gap created by these pads.

The blowout plug is not used on models above 180" of water pressure, medium or high pressure models, or on gages which require an elastomer other than silicone for the diaphragm.

The blowout plug should not be used as a system overpressure control. High supply pressures may still cause the gage to fail due to over pressurization, resulting in property damage or serious injury. Good engineering practices should be utilized to prevent your system from exceeding the ratings or any component.

Die cast aluminum case is precision made and iridite-dipped to withstand 168 hour salt spray corrosion test. Exterior finished in baked dark gray hammerloid. One case size is used for all standard pressure options, and for both surface and flush mounting.

Silicone rubber diaphragm with integrally molded O-ring is supported by front and rear plates. It is locked and sealed in position with a sealing plate and retaining ring. Diaphragm motion is restricted to prevent damage due to overpressures.

Samarium Cobalt magnet mounted at one end of range spring rotates helix without mechanical linkages.

Model	Range Inches of Water	Model	Range PSI	Model	Range MM of Water	Model	Range, kPa	Dual Scale Air Velocity Units For use with pitot tube																				
2000-00N††	0.05-0.2	2201	0-1	2000-6MM††	0-6	2000-0.5KPA	0-0.5	<table border="1"> <thead> <tr> <th>Model</th> <th>Range in W.C./ Velocity F.P.M.</th> </tr> </thead> <tbody> <tr> <td>2000-00AV††</td> <td>0-.25/ 300-2000</td> </tr> <tr> <td>2000-0AV†</td> <td>0-.50/ 500-2800</td> </tr> <tr> <td>2001AV</td> <td>0-1.0/ 500-4000</td> </tr> <tr> <td>2002AV</td> <td>0-2.0/ 1000-5600</td> </tr> <tr> <td>2005AV</td> <td>0-5.0/ 2000-8800</td> </tr> <tr> <td>2010AV</td> <td>0-10/ 2000-12500</td> </tr> </tbody> </table>	Model	Range in W.C./ Velocity F.P.M.	2000-00AV††	0-.25/ 300-2000	2000-0AV†	0-.50/ 500-2800	2001AV	0-1.0/ 500-4000	2002AV	0-2.0/ 1000-5600	2005AV	0-5.0/ 2000-8800	2010AV	0-10/ 2000-12500						
Model	Range in W.C./ Velocity F.P.M.																											
2000-00AV††	0-.25/ 300-2000																											
2000-0AV†	0-.50/ 500-2800																											
2001AV	0-1.0/ 500-4000																											
2002AV	0-2.0/ 1000-5600																											
2005AV	0-5.0/ 2000-8800																											
2010AV	0-10/ 2000-12500																											
2000-00††	0-.25	2202	0-2	2000-10MM†	0-10	2000-1KPA	0-1																					
2000-0†	0-.50	2203	0-3	2000-15MM	0-15	2000-1.5KPA	0-1.5																					
2001	0-1.0	2204	0-4	2000-25MM	0-25	2000-2KPA	0-2																					
2002	0-2.0	2205	0-5	2000-30MM	0-30	2000-2.5KPA	0-2.5																					
2003	0-3.0	2210*	0-10	2000-50MM	0-50	2000-3KPA	0-3																					
2004	0-4.0	2215*	0-15	2000-80MM	0-80	2000-4KPA	0-4																					
2005	0-5.0	2220*	0-20	2000-100MM	0-100	2000-5KPA	0-5																					
2006	0-6.0	2230**	0-30	2000-125MM	0-125	2000-8KPA	0-8																					
2008	0-8.0	<table border="1"> <thead> <tr> <th>Model</th> <th>Range, CM of Water</th> </tr> </thead> <tbody> <tr> <td>2000-15CM</td> <td>0-15</td> </tr> <tr> <td>2000-20CM</td> <td>0-20</td> </tr> <tr> <td>2000-25CM</td> <td>0-25</td> </tr> <tr> <td>2000-50CM</td> <td>0-50</td> </tr> <tr> <td>2000-80CM</td> <td>0-80</td> </tr> <tr> <td>2000-100CM</td> <td>0-100</td> </tr> <tr> <td>2000-150CM</td> <td>0-150</td> </tr> <tr> <td>2000-200CM</td> <td>0-200</td> </tr> <tr> <td>2000-250CM</td> <td>0-250</td> </tr> <tr> <td>2000-300CM</td> <td>0-300</td> </tr> </tbody> </table>		Model	Range, CM of Water	2000-15CM	0-15		2000-20CM	0-20	2000-25CM	0-25	2000-50CM	0-50	2000-80CM	0-80	2000-100CM	0-100	2000-150CM	0-150	2000-200CM	0-200	2000-250CM	0-250	2000-300CM	0-300	2000-10KPA	0-10
Model	Range, CM of Water																											
2000-15CM	0-15																											
2000-20CM	0-20																											
2000-25CM	0-25																											
2000-50CM	0-50																											
2000-80CM	0-80																											
2000-100CM	0-100																											
2000-150CM	0-150																											
2000-200CM	0-200																											
2000-250CM	0-250																											
2000-300CM	0-300																											
2010	0-10	Zero Center Ranges		2000-150MM	0-150	2000-15KPA	0-15																					
2012	0-12	Zero Center Ranges		2000-200MM	0-200	2000-20KPA	0-20																					
2015	0-15	Zero Center Ranges		2000-250MM	0-250	2000-25KPA	0-25																					
2020	0-20	Zero Center Ranges		2000-300MM	0-300	2000-30KPA	0-30																					
2025	0-25	Zero Center Ranges		Zero Center Ranges		Zero Center Ranges																						
2030	0-30	Zero Center Ranges		2300-6MM††	3-0-3	2300-1KPA	.5-0-5																					
2040	0-40	Zero Center Ranges		2300-10MM†	5-0-5	2300-2KPA	1-0-1																					
2050	0-50	Zero Center Ranges		2300-20MM†	10-0-10	2300-2.5KPA	1.25-0-1.25																					
2060	0-60	Zero Center Ranges		Model	Range, Pa	2300-3KPA	1.5-0-1.5																					
2080	0-80	Zero Center Ranges		2000-60NPA††	10-0-50	Dual Scale English/Metric Models																						
2100	0-100	Zero Center Ranges		2000-60PA††	0-60	Model	Range, in w.c.	Range, Pa or kPa																				
2120	0-120	Zero Center Ranges		2000-100PA†	0-100	2000-00D††	0-.25	0-62 Pa																				
2150	0-150	Zero Center Ranges		2000-125PA†	0-125	2000-0D†	0-0.5	0-125 Pa																				
2160	0-160	Zero Center Ranges		2000-250PA	0-250	2001D	0-1.0	0-250 Pa																				
2180*	0-180	Zero Center Ranges		2000-300PA	0-300	2002D	0-2.0	0-500 Pa																				
2250*	0-250	Zero Center Ranges		2000-750PA	0-750	2003D	0-3.0	0-750 Pa																				
Zero Center Ranges				2300-4CM	2-0-2	2004D	0-4.0	0-1.0 kPa																				
2300-00††	0.125-0-0.125	†These ranges calibrated for vertical scale position.		2300-10CM	5-0-5	2005D	0-5.0	0-1.25 kPa																				
2300-0†	.25-0-.25	• Accuracy +/-3%		2300-30CM	15-0-15	2006D	0-6.0	0-1.5 kPa																				
2301	5-0-.5	•• Accuracy +/-4%		Zero Center Ranges		2008D	0-8.0	0-2.0 kPa																				
2302	1-0-1	*MP option standard		Model	Range, Pa	2010D	0-10	0-2.5 kPa																				
2304	2-0-2	**HP option standard		2300-60PA††	30-0-30	2015D	0-15	0-3.7 kPa																				
2310	5-0-5			2300-100PA†	50-0-50	2020D	0-20	0-5 kPa																				
2320	10-0-10			2300-120PA	60-0-60	2025D	0-25	0-6.2 kPa																				
2330	15-0-15			2300-200PA	100-0-100	2050D	0-50	0-12.4 kPa																				
				2300-250PA	125-0-125	2060D	0-60	0-15 kPa																				
				2300-300PA	150-0-150																							
				2300-500PA	250-0-250																							
				2300-1000PA	500-0-500																							

VELOCITY AND VOLUMETRIC FLOW UNITS

Scales are available on the Magnehelic® that read in velocity units (FPM, m/s) or volumetric flow units (SCFM, m³/h). Stocked velocity units with dual range scales in inches w.c. and feet per minute are shown above. For other ranges contact the factory.

When ordering volumetric flow scales please specify the maximum flow rate and its corresponding pressure. Example: 0.5 in w.c. = 16,000 CFM.

ACCESSORIES

- A-321, Safety Relief Valve
- A-448, 3-piece magnet kit for mounting Magnehelic® gage directly to magnetic surface
- A-135, Rubber gasket for panel mounting
- A-401, Plastic Carry Case

A-310A 3-Way Vent Valves

In applications where pressure is continuous and the Magnehelic® gage is connected by metal or plastic tubing which cannot be easily removed, we suggest using Dwyer A-310A vent valves to connect gage. Pressure can then be removed to check or re-zero the gage.

