

Trionic E-194 BPK



DESCRIPTION AND GENERAL PROPERTIES

- **Material** Natural latex, neoprene and nitrile
- **Length (cm)** 36
- **Thickness (mm)** 0.50
- **Wrist** Straight cuff
- **Colour/Color** Non pigmented
- **Interior finish** Chlorinated
- **Exterior finish** Embossed texture
- **Size / EAN** 6 7 8 9 10 11
- **Packaging** 12 pair/bag - 72 pairs/carton
- **Complementary information** Guaranteed without silicone
Controlled Environment Gloves
Class 10 (ISO 4) Compatible



PERFORMANCE RESULTS

Certification category 3

CE 0334




1110

Legends



MECHANICAL HAZARDS EN 388

PERFORMANCE LEVELS

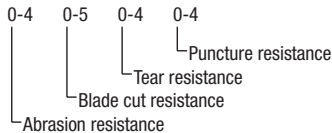

LOW CHEMICAL PROTECTION EN 374



MICRO-ORGANISMS EN 374



RADIOACTIVE CONTAMINATION EN 421




SPECIFIC CHEMICAL PROTECTION EN 374

Letter Code	Chemical product
A	Methanol
B	Acetone
C	Acetonitrile
D	Dichloromethane
E	Carbon Disulfide
F	Toluene
G	Diethylamine
H	Tetrahydrofurane
I	Ethyl acetate
J	n-Heptane
K	Sodium hydroxide 40%
L	Sulphuric acid 96%




COLD HAZARDS EN 511

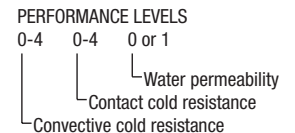

HEAT AND FIRE EN 407

PERFORMANCE LEVELS

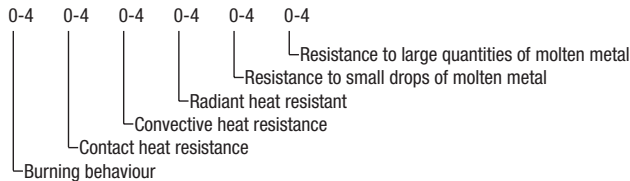

For more details: www.mapa-pro.com

MAPA[®]
PROFESSIONAL

www.mapa-pro.com

SPECIFIC ADVANTAGES

- Excellent resistance and strong chemical protection against a great number of chemical products: exclusive Trionic formula made from a mix of natural latex, neoprene and nitrile
- Manufacturing process guarantees a very low level of contaminants: rates of particles, non-volatile residue, extractables => compatible with ISO 4 class 10
- Extensive range adapted to all applications: wide cuff for double-gloving, extended length to protect the forearm

MAIN FIELDS OF USE

Mapa Advantech :

- Controlled Environment: Product and user protection

INSTRUCTIONS FOR USE

Instructions for use

- It is recommended to check that the gloves are suitable for the intended use, because the conditions of use at workplace may differ from the "CE"-type tests.
- It is not recommended for persons sensitized to natural latex, dithiocarbamates and thiazoles to use these gloves.
- Unpack and put on the gloves according to the gowning procedure in the workplace.
- Inspect the gloves for any cracks and flaws before use.
- Put the gloves on dry, clean hands. Place the fingers into the glove. Gently pull the glove over the hand and make final adjustments only when both hands are gloved.
- Do not use the gloves in contact with a chemical for a duration in excess of the measured breakthrough time. Refer to the website www.mapa-pro.com or contact the Technical Customer Service - MAPA PROFESSIONNEL (stc.mapaspontex@mapaspontex.fr) in order to know this breakthrough time. Use 2 pairs alternatively when in long duration contact with a solvent.
- Turn the cuff end down in order to prevent a hazardous chemical from dripping onto the arm.
- Do not touch the external side of the gloves when taking them off.

Storage conditions

- Store the gloves in their original packaging protected from direct sunlight, far from heat sources or electric equipment.

Food contact US

- FDA 21CFR 177.2600

LEGISLATION

- This product is not classified as hazardous according to the directive 1999/45/EC of the European Parliament and of the Council.

- This product does not contain any substances of very high concern according to the regulation n° 1907/2006 of the European Parliament and of the Council (REACH).

- **UE type certificate or CE type examination certificate** : 0072/014/162/12/96/0676
- **Issued by the notified body nr** : 0072 - I.F.T.H – Av. Guy de Collongue - F-69134 ECULLY CEDEX
- **Quality assurance certificat** : 0334 Asqual 14 rue des Reculettes -F-75013 PARIS